

Date: Wednesday, 10/3/2007 8:41:37 AM  
 User: Kim Johnston

## Process Sheet

46

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206 A/B HIGH GEAR SKIDTUBE  
 Job Number : 34991  
 Estimate Number : 10161  
 P.O. Number : N/A Part Number : D206642211  
 This Issue : 10/3/2007 S.O. No. : N/A Drawing Number : N/A  
 Prsht Rev. : NC Project Number : N/A  
 First Issue : N/A Type : LANDING GEAR Drawing Revision : N/A  
 Previous Run : 34990 Material : N/A  
 Due Date : 11/11/2007 Qty: 1 Um: Each  
 Written By :  
 Checked & Approved By : 7.10.03  
 Comment : Est Rev: 04.08.06 Revised Step 4 per CHG003 KJ/JLM J 0  
 4.08.06

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP206-642-211 CHG004

KS 7.10.15

2.0 34991A HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B



Comment: Sub-Component HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

D206-642-241 B 34991A

3.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0 D206651041 206 A/B GHW Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D206-651-041 GHW Kit

1330235

SD

5.0 D2652 Bushing



Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

16 D2652

Bushing

1334893

7-11-14 SD

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 34991

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D2655

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2655

Tow Ring

B32612

SO

7.0

D26651

Saddle, LH Fwd Aft Out



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 D2665-1

Saddle

32503

SO

P70

8.0

D26661

Saddle, LH, Fwd, Aft, In



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 D2666-1

Saddle

33797

SO

9.0

D2712

Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

10 D2712

Set Screw

34628

SO

10.0

D2884

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

SADDLE SPACER

Batch:

32778

SO

11.0

D2885

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Saddle Spacer






34782

7-11-14 SO

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D206-642-211 PAR #: N/A Fault Category: Prod / Packaging NCR: (Yes) No DQA: 12 Date: 07/11/16  
 QA: N/C Closed: 12 Date: 07.11.19

NCR: <u>34911</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
07.11.14	7.0 6.0 12.0	Parts mixed up, and B# on D2665-1 saddles do not match W/O. D2665-1 in box is B32505, B33090 written on W/O. R.C: Human error	 0510412	Ensure to keep kits matching hardware with the correct order. Ensure Part B#'s match W/O.	 07.11.14	 07.11.14	 0510412	 07.11.14

NOTE: Date & initial all entries

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 34991

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

AN341A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN3-41A

Bolt

M105428

M105810

M104156 (K1)

13.0

AN45A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 AN4-5A

Bolt

M100857

50

14.0

AN46A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 AN4-6A

Bolt

M104322

50

15.0

AN57A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-7A

Bolt

M105426

50

16.0

AN511A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-11A

Bolt

M105810

50

17.0

AN644A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 AN6-44A

Bolt

M102079

7-11-14 50

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 10/3/2007 8:41:37 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 AVB HIGH GEAR SKIDTUBE

Job Number: 34991

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

AN960JD10

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

HI 8 AN960JD10

Washer M104625

SD

19.0

AN960JD416

Washer



Comment: Qty.: 25.0000 Each(s)/Unit Total : 25.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

HI 25 AN960JD416

Washer M103426

SD

20.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD516

Washer M104156

SD

21.0

AN960JD616

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN960JD616

Washer M100697

SD

22.0

MS21042L3

Nut



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

HI 8 MS21042L3

Nut (or -3) M104625

SD

23.0

MS21042L4

Nut



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

M105054

7-11-14 SD

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Wednesday, 10/3/2007 8:41:37 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 34991

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

12 MS21042L4 Nut (or -4)

24.0

MS21042L6

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 MS21042L6

Nut (or -6)

1100151

1-11-14 SK

25.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

26.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-211

Location:

B34991

KS 07/11/5

27.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

07/11/16

Job Completion



W 07/11/16

B34991 A

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 10/3/2007 8:42:24 AM  
 User: Kim Johnston

## Process Sheet

46

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B  
 Job Number : 34991A  
 Estimate Number : 10163  
 P.O. Number : N/A Part Number : D206642241  
 This Issue : 10/3/2007 S.O. No. : N/A Drawing Number : D2650 REV E  
 Prsht Rev. : NC Project Number : N/A  
 First Issue : N/A Type : LANDING GEAR Drawing Revision : E  
 Previous Run : 34990A Material : N/A  
 Due Date : 11/11/2007 Qty: 1 Um: Each  
 Written By :  
 Checked & Approved By : 0710:03  
 Comment : Est Rev: 04.12.02 Revised procedural steps KJ/JLM

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP D206-642-241 CHG003

N/A

2.0 D2620 Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2620

Bent Tube 3" OD

B34692

DP

7-10-10

3.0 D32861 Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-1

Doubler

B33092

H

7-10-22

4.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2647

Fwd Cap

B29328

BF 07-10-16

5.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

DP 7-10-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/3/2007 8:42:24 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 34991A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

DP 7-10-10

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R

Aluminum Rod

M 103138

BE 7-10-16

4-Grind weld flush to cap on top surface only.

BE 7-10-16

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

8-Drill pilot holes using Dt 8167.

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

14-Remove indexing edge using DT8741 as per Dwg D2650

15-C'sink GHW rivet holes as per Dwg D2650

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

Er 10/10/22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/3/2007 8:42:24 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 34991A

Part Number: D206642241

Job Number:



Seq. #

Machine Or Operation:

Description:

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

SL 7-10-23

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

SL 7-10-23

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 07-10-23

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

SL 7-10-24

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

Er 07/10/24

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total: 52.0000 Each(s)

Pick:

Qty Part Number Description Batch

52 CR3212-4-04 Rivet 104625

SL 7-10-24

55

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Wednesday, 10/3/2007 8:42:24 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 34991A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

13.0

D26543

206 I-Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2654-3

Web

33060

SL

7-10-24

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

SL DP 7-10-24

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 7-10-24 Time: 2:00

Finish Date: 7-10-24 Time: 7:00 AM

SL DP 7-10-24

Pick:

Qty Part Number

Description Batch

A/R Sikaflex-291

105408

Sikaflex expire date:

8-7-1

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Er 07/11/25

16.0

D2649

Crossbolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number

Description Batch

18 D2649

Crossbolt spacer

2346 12 BE 07-10-12

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 D3286-3

Spacer

B32781 BE 07/11/06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/3/2007 8:42:24 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 34991A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

18.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod

*M 105138*

*BE 07-10-25*

2-Grind welds flush as per Dwg D2650.

*M 7-10-25*

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod

*NONE BE 07/11/01*

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr

*BE 07/11-06*

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets

*103525*

*BE 07/11/06*

20.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets

*102515*

*BE 07/11/06*

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041

Nut Plate *33061*

*BE 07/11/06*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/3/2007 8:42:24 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 34991A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

BE 07/11/06

23.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 07-11-06 (1)

24.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 07/11/06

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

M-1

07/11/12

(IX)

26.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

M 105914

FL 07/11/12 (P)

27.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BL 07-11-12

28.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

B33059

BL

29.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-13

Wearshoe

B33419

BL 07-11-12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/3/2007 8:42:24 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 34991A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

B27075

BR

31.0

D265633

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-33

Wearshoe

B34884

BR

32.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3429-1

Wearpad

B34012

BR

33.0

ALS41032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 ALS4-1032-130 Inserts

or (see QSI 017)

M105729

BR

34.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 AN960JD10L

Washer

m 104374

BR

BR

07-11-12

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Wednesday, 10/3/2007 8:42:25 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 34991A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

MS27039108

Screw



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number Description Batch

44 MS27039-1-08 Screw M 104547

BR

36.0

D26511

Plug



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number Description Batch

18 D2651-1 Plugs B 33349

BR

37.0

D26513

O-Ring



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number Description Batch

18 D2651-3 O-Rings B 33087

BR

38.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 MS27039-4-06 Screw M 15194

BR

39.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960JD416 Washer M 105426

BR

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

M 105585

BR 07-11-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/3/2007 8:42:25 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 34991A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

Sikaflex expire date: 08-07

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

41.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646

Aft Cap

B 31335

BL

42.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 MS27039-1-08 Screw

M 104517

BL

43.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 AN960JD10L

Washer

M 104374

BL

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date:

M 105585

08-07

BL 07-11-12

2-Wing Walk as per Dwg D2650-3 and QSI 005.4.4

Batch:

M 106030

BL

07-11-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/11/16  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/3/2007 8:42:25 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 34991A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

45.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

07-11-14

46.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07-11-14

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location: 334991

PPP Rev:

Rev D

AS 07/11/15

48.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

1

07/11/16

Job Completion



07/11/16

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART**

DESIGN <i>UP</i>	DRAWN BY <i>UP</i>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

RELEASED  
16 04 17 *PH*

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

**NOTES**

- WELD PER DART QSI 004
- DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 SHOP COPY INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3  
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED



INCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO 34991A

**Copyright © 1997 by DART AEROSPACE USA, INC.**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.






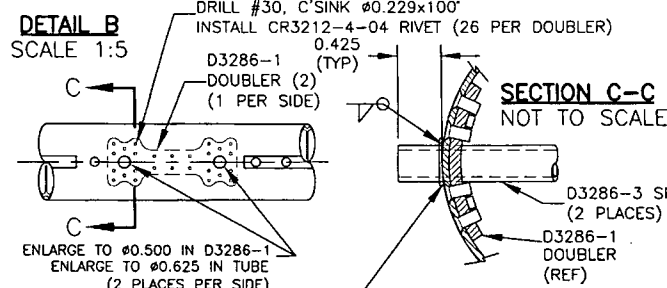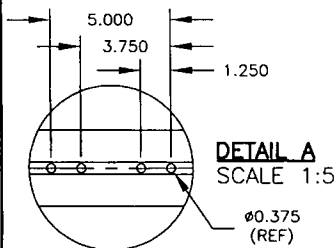

### SECTION C-C NOT TO SCALE

ENLARGE TO  $\phi 0.500$  IN D3286-1  
ENLARGE TO  $\phi 0.625$  IN TUBE  
(2 PLACES PER SIDE)

- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
  2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
  3. ENLARGE HOLES IN D3286-1 TO  $\phi 0.500$
  4. ENLARGE HOLES IN TUBE TO  $\phi 0.625$  AND CHAMFER HOLE  $0.030 \times 45^\circ$
  5. RIVET D3286-1 TO TUBE
  6. INSERT D3286-3 SPACER
  7. WELD IN PLACE AND GRIND FLUSH


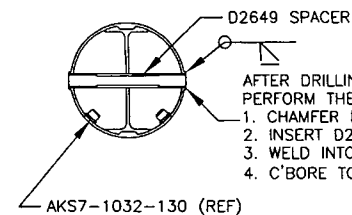


- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR  $\phi 0.375$  HOLES ONLY:
1. CHAMFER HOLE  $0.030 \times 45^\circ$
  2. INSERT D2649 SPACER
  3. WELD INTO PLACE AND GRIND FLUSH
  4. C'BORE TO  $\phi 0.313 \times 0.75$  DEEP

RELEASED

66-0417


### DETAIL E SCALE 1:5

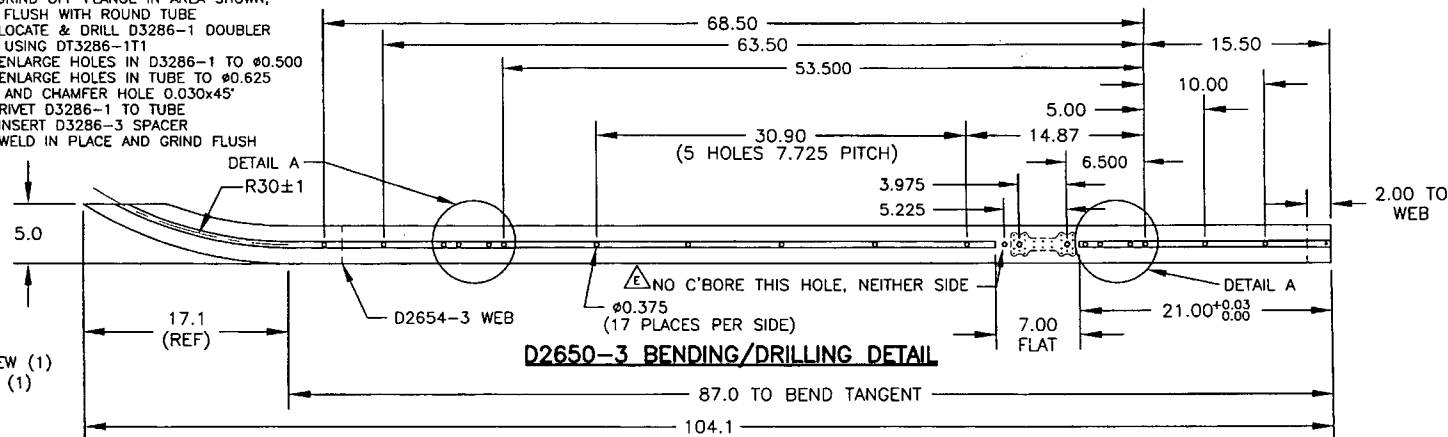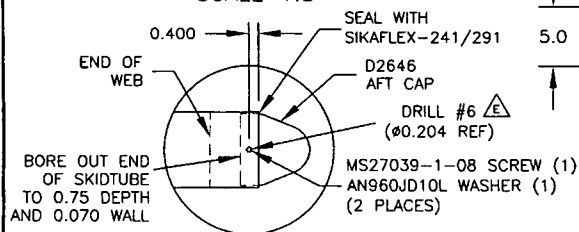


### DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE  
LEAVE 0.070 MIN.

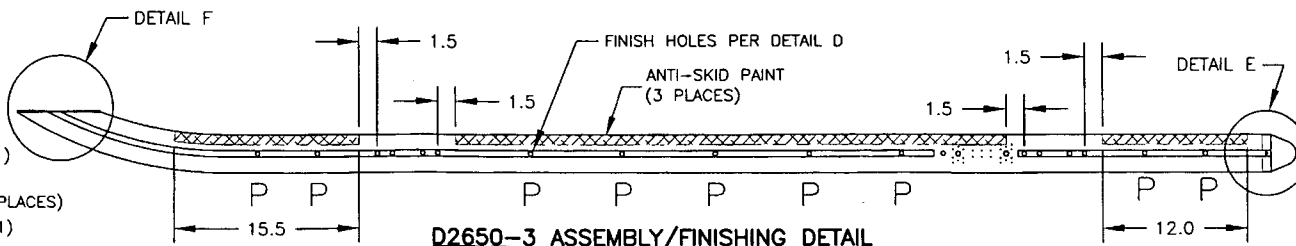

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	UP	DRAWN BY	UP	<b>DART</b> DART AEROSPACE USA, INC.	REV. E
CHECKED	PH	APPROVED	PH	DART	SHEET 3 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10

NO. 34991A  
WORK ORDER  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
SHOP COPY  
RETURN TO  
ENGINEERING

DESIGN	DRAWN BY	 <b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED	APPROVED	DRAWING NO.	REV. E
PH		D2650	SHEET 4 OF 5
DATE		TITLE	SCALE
06.03.30		SKIDTUBE	1:10



NO. 131

# AWS D17.1.2001 QUALIFICATION TEST RECORD

Name Barclay Elliot  
 Joint Welding Procedure E.S.  
 Part number and Job number DDCK-612 541 / 634772

## TEST WELDS REQUIRED

BASE METAL Aluminum WELDING PROCESS E.S.  
 Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
 Current AC ☐ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical Down <input type="checkbox"/> Up <input type="checkbox"/>	
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/> 4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/> 6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/> 4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/> 5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skid tube

## TEST RESULTS

Visual Pass ☒ Fail ☐  
 Penetration Pass ☒ Fail ☐  
 Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07-10-99 Qualifier Pat Darr